


LB

Barb Branch Tee

CAD

RoHS compliant

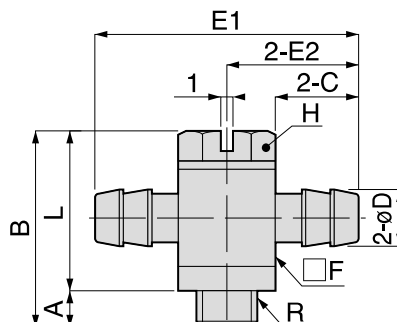

Unit : mm

Model code	Tube I.D. øD	R	A	B	L	C	E1	E2	Hex. H	□F	Weight (g)	Orifice dia.	Effective area (mm ²)	CAD file name
LB-0320-M3□	2	M3×0.5	2.2	11.5	9.3	6	17.5	8.75	5.5	5.5	2	1.0	0.5	—
LB-0320-M5□		M5×0.8	3.2	16	12.8		20	10	7	8	5.3	1.2	0.8	
LB-0425-M3□	2.5	M3×0.5	2.2	11.5	9.3	7	19.5	9.75	5.5	5.5	2.1	1.0	0.5	
LB-0425-M5□		M5×0.8	3.2	16	12.8		22	11	7	8	5.4	1.6	1.2	
LB-0640-M5□	4	M5×0.8	3.2	16	12.8	7	22	11	7	8	6.5	1.8	1.5	TFMF-002


※ 1. □ in Model code / Replaced with "C" for Clean-room package

※ 2. Be sure to place Tube Clamp Sleeve on the edge of outer tube in order to avoid the escape of tubes.

LU

Barb Union Straight

RoHS compliant

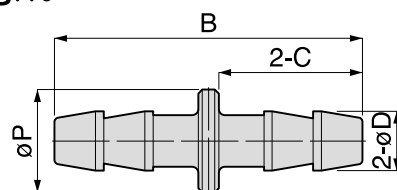

Unit : mm

Model code	Tube I.D. øD	B	C	øP	Weight (g)	Orifice dia.	Effective area (mm ²)
LU-0320□	2	13	6	4	0.4	1.2	0.9
LU-0425□	2.5	15	7	5	0.6	1.6	1.7
LU-0640□	4	15.6	7	7.5	1.8	2.4	3.8


※ 1. □ in Model code / Replaced with "C" for Clean-room package

※ 2. Be sure to place Tube Clamp Sleeve on the edge of outer tube in order to avoid the escape of tubes.

LG

Unequal Barb Union Straight

RoHS compliant

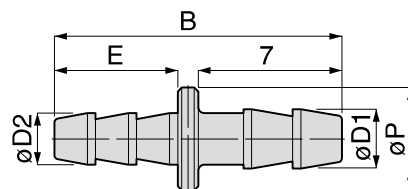

Unit : mm

Model code	Tube I.D. øD1	Tube I.D. øD2	B	E	øP	Weight (g)	Orifice dia.	Effective area (mm ²)
LG-0425-0320□	2.5	2	14	6	5	0.6	1.2	0.9
LG-0640-0320□	4	2	14.6	6	7.5	1.5	1.2	0.9
LG-0640-0425□		2.5	15.6	7		1.6	1.6	1.7

※ 1. □ in Model code / Replaced with "C" for Clean-room package

※ 2. Be sure to place Tube Clamp Sleeve on the edge of outer tube in order to avoid the escape of tubes.

CAD

CAD data is available at PISCO website.