


PKD SUS Run Triple Tee

RoHS compliant

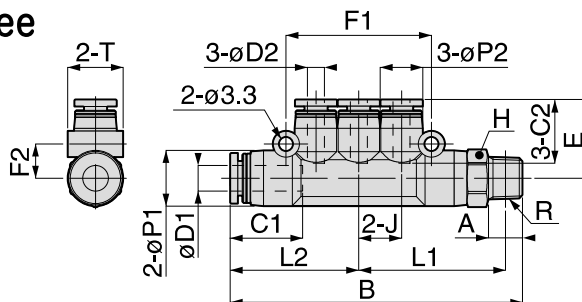


Unit : mm

形式	Tube O.D. øD1	Tube O.D. øD2	R	A	B	E	L1	L2	J	øP1	øP2	Tube end C1	Tube end C2	F1	F2	Hex. H	T	Effective area (mm ²)	Weight (g)	CAD file name
PKD6-4-01SUS	6	4	R1/8	8	68.5	18.5	34.3	30.2	10	13	10	17.1	15	34	8	12	13	5	23	PKD6-4-01SUS
PKD8-4-02SUS	8	4	R1/4	11	73.7	19.3	36.5	31.2	10	15	10	18.1	15	34	9.2	14	15	5.2	32	PKD8-4-02SUS
PKD8-6-02SUS		6			80.7	21.4	40	34.7	12		13		17.1	40.2	9			9.6	35	PKD8-6-02SUS
PKD10-8-03SUS	10	8	R3/8	12	93.2	23.7	46.7	40.2	14	17.5	15	20.9	18.1	46.2	10.5	17	17.5	19.1	57	PKD10-8-03SUS

※. "L1" is a reference value for height dimension after tightening thread.

PKG SUS Unequal Triple Tee

RoHS compliant

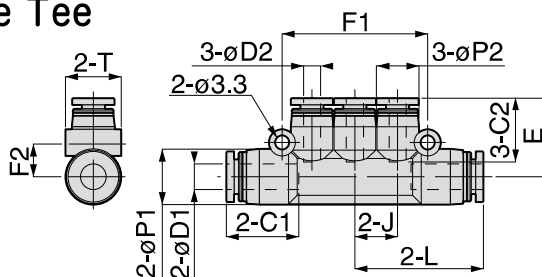


Unit : mm

Model code	Tube O.D. øD1	Tube O.D. øD2	L	E	J	øP1	øP2	Tube end C1	Tube end C2	F1	F2	T	Effective area (mm ²)	Weight (g)	CAD file name
PKG6-4SUS	6	4	30.2	18.5	10	13	10	17.1	15	34	8	13	5	16	PKG6-4SUS
PKG8-4SUS	8	4	31.2	19.3	10	15	10	18.1	15	34	9.2	15	6	19	PKG8-4SUS
PKG8-6SUS		6	34.7	21.4	12		13		17.1	40.2	9		10.1	23	PKG8-6SUS
PKG10-6SUS	10	6	40.2	23.9	14	17.5	15	20.9	17.1	46.2	10.5	17.5	11.2	31	PKG10-6SUS
PKG10-8SUS		8		23.7					18.1				19.1	33	PKG10-8SUS

PRX SUS Branch Double Y

RoHS compliant

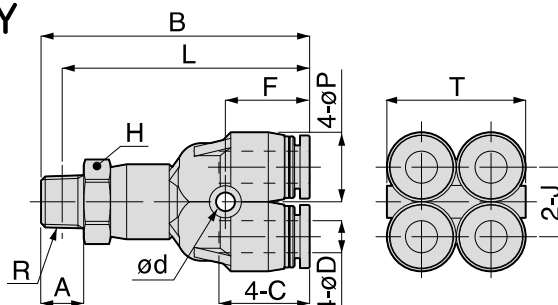

Unit : mm

Model code	Tube O.D. øD	R	A	B	L	øP	Tube end C	J	Hex. H	ød	F	T	Effective area (mm ²)	Weight (g)	CAD file name
PRX4-01SUS	4	R1/8	8	45.8	41.8	10.5	15	10	12	3.2	14.3	20.5	1.5	21	PRX4-01SUS
PRX4-02SUS		R1/4	11	48.8	42.8				14				1.4	28	PRX4-02SUS
PRX6-01SUS	6	R1/8	8	50.4	46.4	13	17.1	13	14	3.5	15.9	26	9	28	PRX6-01SUS

※. "L" is a reference value for height dimension after tightening thread.